


## ABS Coaxial Cable Product Type: T10875

875 Series Coaxial Cable
Copper Clad Aluminum Conductor
Foamed Polyethylene Dielectric
Seamless Aluminum Tube Outer Conductor

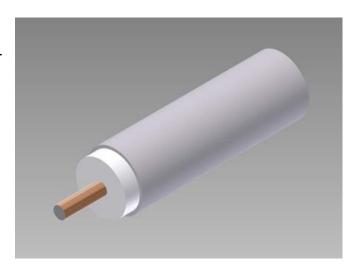

Cable Ordering Information

Part Number	Description	NEC / CSA Listing	
750875A000AL00100001	T10875	n/a	

## Characteristics

Material	Detail	inches	mm
Inner Conductor	Copper Clad Aluminum	0.194	4.93
Dielectric	Foamed Polyethylene	0.797	20.2
Outer Conductor	Seamless Aluminum Tube	0.875	22.2
Floodant			
Jacket			
Messenger			
Cable Width			
Mechanical Specifications			
Minimum Bend Radius, in. (mm)		8.0	( 203)
Product Weight, lbs/kft (kg/km)	(less reel)	208	( 310)

Customers are reminded that they are SOLELY responsible for confirming that all products are properly installed and used in accordance with all applicable codes and regulations.

Document: t10875\_1.8ghz18.docx

Revision: 12.05.2018 Page: 1 of 2

uncontrolled copy

All Rights Reserved,

Specifications subject to change without notice

Amphenol Broadband Solutions 358 Hall Avenue

Wallingford, CT 06492
Toll Free +1-800-677-2288
Toll +1-434-432-1800
Fax +1-434-432-1821
www.timesfiber.com



## ABS Coaxial Cable Product Type: T10875

Electrical Specifications				
Impedance, Ω	75 ± 2			
Velocity of Propagation, %	87			
Capacitance, Nominal	15.3 pF/ft	50.2 pF/m		
DC Resistance	Ω / kft	$\Omega$ / km		
Inner Conductor	0.42	1.38		
Outer Conductor	0.13	0.43		
Loop	0.55	1.81		
Structural Return Loss, minimum	dB			
5~1002 MHz	30			

Attenuation, Maximum @ 68 °F (20 °C)					
Frequency, MHz	dB / 100 ft	dB / 100 m			
5	0.09	0.30			
55	0.32	1.05			
211	0.64	2.09			
250	0.70	2.31			
270	0.73	2.40			
300	0.78	2.56			
330	0.82	2.69			
350	0.84	2.76			
400	0.91	2.99			
450	0.97	3.18			
500	1.03	3.38			
550	1.09	3.58			
600	1.14	3.74			
750	1.29	4.23			
870	1.41	4.63			
1002	1.53	5.02			
1100	1.61	5.28			
1200	1.69	5.54			
1218	1.70	5.58			
1300	1.76	5.77			
1400	1.84	6.04			
1500	1.93	6.33			
1600	2.00	6.56			
1700	2.05	6.73			
1794	2.12	6.96			
1800	2.13	6.99			

Customers are reminded that they are SOLELY responsible for confirming that all products are properly installed and used in accordance with all applicable codes and regulations.

Document: t10875\_1.8ghz18.docx

Revision: 12.05.2018 Page: 2 of 2

## uncontrolled copy

All Rights Reserved, Specifications subject to change without notice Amphenol Broadband Solutions 358 Hall Avenue Wallingford, CT 06492

Toll Free +1-800-677-2288
Toll +1-434-432-1800
Fax +1-434-432-1821
www.timesfiber.com